

Air Suspension Height Sensor Modifications.

Models	LA - Discovery 3 LS - Range Rover Sport
Title	Air Suspension Height Sensor Modifications.
Last Modified	11-NOV-2008 13:05
Category	Chassis
Symptom	304000 Suspension System

Issue:

The air suspension warning lamp may illuminate causing the ride height to become frozen. DTC's C1A03, C1A04, C1A05, C1A06, C1A72, C1A73, C1A74 and C1A75 may also be recorded.

Cause:

Manufacturing process improvements have been made to the height sensors to overcome the symptoms previously mentioned.

Action:

Content	The improved level height sensors were introduced to production at VIN numbers: LS 9A199490 LA 9A502505
---------	---

All service parts are now to the new level. These can be identified by a date code on the end of the sensor (see attachment). The assured date code is 21108 where 211 is the day of the year and 08 is the year.

If any issues of this nature are experienced POST these VIN's or assured date code please submit an ePQR.