

Id 37759

Models LS - Range Rover Sport

Title Tyre tread pattern - Continental 4x4 Sport Contact tyres

Last Modified 27-SEP-2010 08:27

Category Chassis

Symptom 306000 Tyres/Wheels

Issue.

A customer may report uneven tyre wear on vehicles fitted with 20 inch wheels and Continental 4x4 Sport Contact tyres.

Cause.

With reference to the photo attached, Due to the tread pattern design of this tyre, there can appear to be inner or outer shoulder wear. This is in fact just the natural tread wear, but as the design of the lateral grooves continues around to the sidewall, the very ends of the grooves do not wear giving rise to a "band" of wear at the edge of the contact patch.

Content

Action.

Where applicable please review this SSM before carrying out tyre replacement or geometry adjustment under warranty as no action is required for this issue. It is deemed a characteristic of the tyre and not a fault.

Cosmetic effect only



This groove is only half depth to start with, so disappears when tyre half worn

Tread wear indicators - 1.5mm left when the tread wears down to the top. Uneven wear should be measured against those.