



Technical Service Bulletin

No.LTB00203v2
21 April 2009

Reissue

Please replace the previous edition of this bulletin.

This bulletin supersedes TSB LTB00203/2008 dated 05 February, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page).

Subject/Concern : Driver Air Bag Module Distorted

Models :		
Discovery 3 / LR3		VIN- range : All Onwards
Freelander 2		VIN- range : All Onwards
Range Rover Sport (LS)		VIN- range : All Onwards

Markets : All

Section : 501-20B

Summary :
Driver Air bag Module lifts up at the top edge (cosmetic issue).
This version has been issued for a change in the Causal Part.
Cause : Expansion co-efficient difference between the two layers of material that form the cover. Suggested Customer Concern Code - C03.
Action : Should a customer express concern, follow the Service Instruction outlined below.

Parts Required :		
Description	Part Number	Quantity
Drivers Airbag module – Green emblem - Discovery 3 / LR3 and Range Rover Sport - Naturally Aspirated	LR012986	1
Drivers Airbag module – Black emblem - Range Rover Sport - Supercharged	LR012987	1
Drivers Airbag module –Freelander/LR2	LR012988	1

Labour Time :		
Operation Description	Operation No.	Time
Driver Air Bag module - Install	76.74.01	0.1 hours

Repair/Claim Coding :	
Causal Part :	EHM500930PVJ
ACES Condition Code :	42
Defect Code :	

Service Instruction

- 1 . Driver Air Bag module - Install (see Global Technical Reference GTR Workshop Manual, section 501-20B (76.74.01)).

© 2009 LandRover