

Technical Service Bulletin

No.LS412-001

06 January 2006

Subject/Concern: Range Rover Sport - Omission of Fuel-Fired Booster Heater

Models:

Range Rover Sport (LS)	Diesel engine derivatives	Diesel engine derivatives VIN-range: 5A90506-5A904584
------------------------	---------------------------	---

Markets: Canary Isles, Cyprus, France, Gibraltar, Italy, Malta, Morocco, Portugal, Spain, Turkey and UK only.

Section: 412-02B

Summary:

A customer may report a concern that in cold conditions the cabin is slow to warm up and that heater performance is generally poor, or that the auxiliary fuel-fired booster heater is not working.

Cause: The vehicle has not been installed with an auxiliary fuel-fired booster heater (FFBH) due to a specification error during build.

Action: On a customer complaint basis only, refer to the Service Procedure detailed in this bulletin to retro-install the auxiliary heater.

Parts Required:

Description	Part Number	Quantity
Fuel pump cover (access flange)	WGC500044	1
Fuel line – FFBH pump to FFBH	WJP500385	1
Clip	KYC500020	7
Fuel line – FFBH pump to tank	WFP500078	1
FFBH fuel pump and filter	JEX000043	1
Screw	FS106257L	3
FFBH assembly	JEC500790	1
Muffler	JEZ500050	1
Screw	FS106127L	2
Nut	AWR6715	2
Hose Assembly – FFBH to heater	JHB500822	1
FFBH pump harness kit	YNI500420	1
Fuel Pump Module	WGS500071	1
Seal (Gasket)	WGQ000031	1
Adhesive Pad	WFK500011	1
Hose Clip	WYC100780L	1

NOTE: Claims must be submitted using the appropriate parts shortage code.

Labour Time:

Operation Description	Operation No.	Time
Retro install fuel burn heater feature	80.40.89/29	4.80 hours